

SmartScreen Motorized




Maintenance & Service



Rescreen

- 1) Package and unit visual inspection.
 - a) If the **packages** are damaged, the **unit** may still be free of damage. **No matter, you must mark the external damage on the waybill.**
 - b) Report any potential damage to Wizard Screens **immediately** with pictures.
- 2) Carefully remove components from packages. **Do not cut screen!**
 - a) If it was requested to fold mesh to reduce shipping costs, there will initially be creases. These will disappear after use.
 - b) **Heavy fabrics & clear vinyl** is always shipped rolled on a tube.
- 3) Send screen to the *upper limit*.
- 4) Remove the **housing cover** and set aside.
- 5) Detach the **tracks** and set aside.
- 6) Send screen to a comfortable position to remove **bottom-bar**.
- 7) Remove **probes** and set aside.
- 8) Remove **bottom-bar** and set aside.
- 9) Send screen to *lower limit*. Hold the screen at the middle to guide screen down.
- 10) Remove *lower limit*, then further lower the screen until the **roll-tube** is positioned so that the zipper is at the bottom and accessible.
- 11) Remove the roofing nails and remove screen from roll-tube. Set aside.
*Note the front-back orientation of the screen.
- 12) Unroll/unfold **rescreen**.
- 13) Ensure the screen is facing the correct way (as you noted the old screen to be).
 - a) The smaller zipper or Keder system at both *left & right sides*.
 - b) The larger zippers at both *top & bottom*.
 - c) The probe tabs at the *bottom*.
- 14) Feed the **rescreen** along the **roll-tube** and *center*. Put roofing nails back in. **Do not stretch too tight.**
- 15) Enter programming mode and reset limits *roughly*.
- 16) Send screen to a comfortable position to refeed the **bottom-bar**.
- 17) Reattach **probes**.
- 18) Reinstall **tracks** per installation process.
- 19) Send screen to the *upper limit*, ensuring the zipper stacks well.
- 20) Enter programming mode and set the limits *precisely*.
- 21) Check both limits and screen functionality.

Add Extra Weight

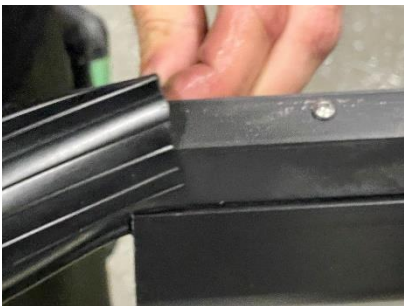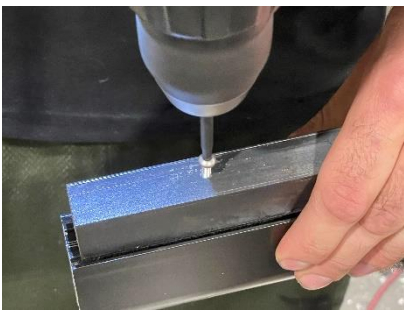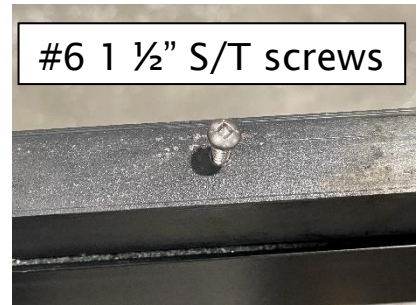

Details and specifications subject to change